



Preparing Smaller-Than-Package-Size Amounts of KODAK Processing Chemicals

SPLITTING PACKAGED CHEMICAL AMOUNTS—YOUR DECISION

You will get the best, most consistent results from Kodak chemicals by mixing them to produce the full volume marked on the package. Kodak supplies photographic chemicals in a variety of sizes to make it easy to choose the volume you need. However, you may want to mix chemicals in amounts that are more suitable for your conditions. Although we do not recommend mixing smaller volumes, we provide this information to simplify calculations. If you measure the chemicals and follow the mixing directions carefully, you should obtain the same results produced by a mix made with the entire package. The information provided here applies to splitting liquid chemicals only.

DIVIDING PACKAGED CHEMICALS


Use one of the following methods. When you select a method, consider the one that offers sufficient protection against oxidation for your needs. These methods are listed in order of preference.

1. Draw off the chemicals from flexible plastic containers stored in an inverted position. Flexible containers stored in this manner keep air and other vapors from coming into contact with the concentrate.
This method has the greatest potential for oxidation.
2. Divide the concentrate into smaller amounts and store them in full stoppered bottles for use as needed.
3. Take the portions from the original bottle as needed.
This method has the greatest potential for oxidation.


If you use method 2 or 3, be sure to use the entire amount within two weeks. This is particularly important with developers or other solutions that are very susceptible to oxidation.

MIXING CHEMICALS



Some basic techniques are important when you mix any photographic chemicals.

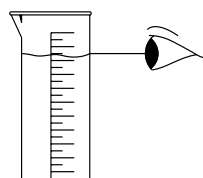

Accurate Measurement is essential. Always read the liquid level at the bottom of the meniscus.



Rinse each container or graduate with a small amount of water and add the rinse water to the mix.

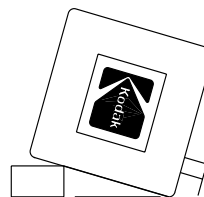

Protect Against Oxidation by storing the unused concentrate properly.

Discard excess concentrate that you draw off accidentally. **Do not** return it to the original container; it can be a source of contamination.

Always add concentrate to the water—never add water to the concentrate.

Use metric measurements whenever possible. The most accurate and widely available measuring devices are calibrated in metric measurements.

Do not split packages of dry chemicals. The components of dry chemicals may not be uniform within the batch.

HOW TO USE THE TABLES

For each chemical, the number of millilitres per litre (mL/L) are given. For larger volumes, use the following conversion factors:

3785 mL	= 1 gal (U.S.)
3.785 L	= 1 gal (U.S.)
1000 mL	= 1 L
29.57 mL	= 1 fl oz
128 fl oz	= 1 gal (U.S.)

Example:

Suppose you have a package of KODAK FLEXICOLOR Developer Replenisher to make 25 U.S. gallons, but you need only 8 gallons. This is how you would determine the amount of each part to use:

1. Find the table for mixing FLEXICOLOR Developer Replenisher from replenisher concentrate (Table 1).
2. Read across the row for 25, 75 gallons of FLEXICOLOR Developer Replenisher. It indicates to start with 700 mL of water at 80 to 90°F (27 to 32°C) for each litre of developer replenisher you prepare.

3. To the water, add 80.0 mL/L of Part A, 9.37 mL/L of Part B, and 10.0 mL/L of Part C. Using these numbers as the basis for calculating the amount of concentrate needed for 8 gallons, multiply each number by

$$3.785 \times 8 = 30.28$$

The starting volume of water is
 $700 \times 30.28 = 21196 \text{ mL}$ or 21.196 L
Round this to 21.2 L

Part A: $80.0 \times 30.28 = 2422.4 \text{ mL}$ or 2.4224 L
Round this to 2.42 L

Part B: $9.37 \times 30.28 = 283.72 \text{ mL}$, rounded to 283.7 mL

Part C: $10.0 \times 30.28 = 302.8 \text{ mL}$ (No rounding needed.)

Therefore, to make an 8-gallon mix, begin with 21.2 L of water and add 2.42 L of Part A, 283.7 mL of Part B, and 302.8 mL of Part C. Complete the mix by adding water to bring the final volume to 8 gallons. Check the instructions packed with the chemicals for mixing times and other information.

Rounding (reducing the decimal places to a reasonable number) before the final step in the calculation and using inaccurate factors are potential sources of error when you split larger sizes to make smaller mixes. Use only the conversion factors given in the following pages to make your calculations.

Table 1
Preparing Replenisher Solutions from Replenisher Concentrates

KODAK Chemical	Package Size	Mixing Temperature °F (°C)	Starting Water (mL)	Part A (mL)	Part B (mL)	Part C (mL)	Additive (mL)	Add Water to Make
Process E-6								
First Developer Replenisher	10 L 5 gal, 25 gal AR	68–104 (20–40)	700 750	200.0 200.0	—	—	—	1 L
Reversal Bath and Replenisher	10 L 5, 25, and 100 gal AR	68–104 (20–40)	750	50.0	—	—	—	1 L
Color Developer Replenisher	10 L	68–104	500	200.0	71.0	—	—	1 L
	5 gal	(20–40)	500	200.0	50.0	—	—	1 L
	25 gal AR			200.0	200.0			
Color Developer Replenisher LORR	25 gal AR	68–104 (20–40)	500	200.0	200.0	—	—	1 L
Pre-Bleach and Replenisher*	10 L	68–104 (20–40)	750	200.0	—	—	—	1 L
Pre-Bleach II and Replenisher	5, 50 gal AR	68–104 (20–40)	750	100.0	—	—	—	1 L
Bleach Replenisher	10 L, 5 gal AR	68–104 (20–40)	—	1000.0†	—	—	—	1 L
Fixer and Replenisher (4 min)	10 L, 5, 25 gal, and 50 gal AR	68–104 (20–40)	750	100.0	—	—	—	1 L
Fixer and Replenisher (2 or 3 min)	10 L, 5, 25 gal, 50 gal AR	68–104 (20–40)	750	125.0	—	—	—	1 L
Final Rinse and Replenisher	10 L, 5, 25 gal 500 gal AR	68–104 (20–40)	800	10.0	—	—	—	1 L

* 10 L size is Pre-Bleach and Replenisher (**not** Pre-Bleach II).

† Use full strength (1000 mL), or dilute 667 mL bleach replenisher with 333 mL water for 6-minute bleach. (See KODAK Publication No. Z-119.)

Preparing Replenisher Solutions from Replenisher Concentrates (continued)

KODAK Chemical	Package Size	Mixing Temperature °F (°C)	Starting Water (mL)	Part A (mL)	Part B (mL)	Part C (mL)	Additive (mL)	Add Water to Make
FLEXICOLOR (Process C-41)								
Developer Replenisher	5 gal 25, 75 gal	80–90 (27–32)	700	75.0	12.5	11.73	—	1 L
Developer Replenisher LORR	5, 10 L, 25 gal 50, 100 gal	70–100 (21–37.8) 70–100 (21–37.8)	800	80.0	11.2	11.2	—	1 L
AR Developer Replenisher	Use FLEXICOLOR AR Developer Replenisher, Part A, CAT No. 826 6801.							
	Part A 5-gal conc Part B 1-gal conc Part C 1-gal conc	70–100 (21–37.8)	901.1	80.0	9.2	9.7	—	—
Bleach III Replenisher	5, 12.5, 75 gal	100–110 (37.8–43)	330	200.0	400.0	—	—	1 L
Bleach III AR	Use FLEXICOLOR Bleach III Replenisher, to make 12.5 gal, Part A, CAT No. 818 4038, Part B, CAT No. 821 4637.							
Bleach III NR Replenisher	5 L	Ready-to-use solution						
RA Bleach Replenisher NR	5 L 5 gal	Ready-to-use solution						
Bleach III Regenerator	5, 25 (two 12.5-gal mixes), 75 gal		1000 bleach overflow	60.0	—	—	—	—
Fixer and Replenisher	5L 5, 25, 75 gal	80–90 (27–32)	700	200.0	—	—	—	1 L
ELECTROSILVER Fixer and Replenisher LORR	75 gal 150 gal	70–80 (21–27) 70–80 (21–27)	500	400.0	—	—	—	1 L
RA Fixer and Replenisher	5,10 L 10 gal	70–100 (21–37.8)	500	500.0	—	—	—	1 L
Stabilizer III and Replenisher	1, 5, 12.5, 75 gal AR	70–100 (21–37.8)	800	15.0	—	—	—	1 L
			800	26.0	—	—	—	1 L
Final Rinse	5, 10 L 12.5, 75 gal	70-100 (21–37.8)	800	9.0	—	—	—	1 L

Preparing Replenisher Solutions from Replenisher Concentrates (continued)

KODAK Chemical	Package Size	Mixing Temperature °F (°C)	Starting Water (mL)	Part A (mL)	Part B (mL)	Part C (mL)	Additive (mL)	Add Water to Make
EKTACOLOR RA (Process RA-4)								
PRIME SP Developer Replenisher	10 L 20 gal	70-100 (21-37.8)	700	130	—	—	—	1 L
Note: With PRIME SP Developer Replenisher, rinse the measuring graduate (or concentrate bottle on last mix) with water to ensure all of the concentrate is used.								
PRIME Developer Replenisher LORR	10 L 25 gal	70-100 (21-37.8)	864.6 700	46.5 46.5	22.2 40.0	66.7 66.7	— —	— 1 L
Developer Replenisher	25 gal 75 gal	70-100 (21-37.8)	700 700	50.0 50.0	42.28 33.0	50.0 50.0	— —	1 L 1 L
Developer Replenisher RT	5 L 10 L 25, 75 gal	80-90 (27-32)	800 800 800	50.0 50.0 50.0	23.4 22.2 30.0	50.0 50.0 50.0	— — —	1 L 1 L 1 L
Developer Replenisher RT with Additive	5 L 10 L 25, 75 gal	80-90 (27-32)	800 800 800	40.0 40.0 40.0	18.7 17.8 24.0	40.0 40.0 40.0	24.0* 24.0* 24.0*	1 L 1 L 1 L
RA Developer Replenisher, 12	150 gal	70-100 (21-37.8)	700	26.7	26.7	66.7	—	1 L
RA Developer Regenerator, 12/55	150 gal 55 gal drums	70-100 (21-37.8)	550 developer overflow	26.7	16.7	26.7	—	1 L†
To make fresh RA Replenisher, 12 from RA Developer Regenerator, 12/55 and RA Developer Regenerator Converter								
RA Developer Regenerator, 12/55	150 gal 55 gal drums	70-100 (21-37.8)	700	40	25	40	40‡	1 L
RA 100 Bleach-Fix and Replenisher	5 L, 5 gal		—	500.0	500.0	—	—	—
PRIME Bleach-Fix Replenisher	10 L, 25 gal	70-100 (21-37.8)	500	200.0	300.0	—	—	—
Bleach-Fix and Replenisher	5, 10 L 25 gal	70-100 (21-37.8)	658 500	142.0 142.0	200.0 200.0	— —	— —	— 1 L
Bleach-Fix and Replenisher with Additive	5, 10 L, 25 gal	70-100 (21-37.8)	500	142.0	200.0	—	15.0§	1 L
RA Bleach-Fix and Replenisher NR	20 gal 60 gal 208 gal	70-100 (21-37.8)	400 400 400	250.0 250.0 250.0	181.0 215.0 128.0	23.44¶ 23.44¶ 23.44¶	— — —	1 L 1 L 1 L
Bleach-Fix Desilvering Concentrate	110 gal	70-100 (21-37.8)	950 bleach-fix overflow	50.0	—	—	—	1 L**
Bleach-Fix Regenerator	110 gal	70-100 (21-37.8)	892 desilvered bleach-fix overflow	34.2	73.8	—	—	1 L ††

* RA Developer Additive, CAT No. 122 4930.

† Adjust pH of regenerated replenisher to 10.75-10.85.

‡ RA Developer Regenerator Converter, Process RA-4, CAT No. 896 9453.

§ RA Bleach-Fix Additive, CAT No. 803 6832.

¶ Use 50 percent of Part C when replenisher will be used to start a working tank.

** Adjust pH to 7.5-8.0 prior to desilvering.

†† Adjust pH to 5.5 ±0.1 to make replenisher.

Preparing Replenisher Solutions from Replenisher Concentrates (continued)

KODAK Chemical	Package Size	Mixing Temperature °F (°C)	Starting Water (mL)	Part A (mL)	Part B (mL)	Part C (mL)	Additive (mL)	Add Water to Make
EKTACOLOR RA (Process RA-4) continued								
Bleach Regenerator	150 gal	70–100 (21–37.8)	901 bleach overflow	99.0	—	—	—	1 L [*]
Bleach Replenisher (using RA Bleach Regenerator)	150 gal	60–80 (15.6–27)	600	250	—	—	—	1 L [*]
Fixer Regenerator	150 gal	70–100 (21–37.8)	800 fixer overflow	200	—	—	—	1 L [†]
Fixer Replenisher (using RA Fixer Regenerator)	150 gal	70–100 (21–37.8)	600	333	—	—	—	1 L [‡]
PRIME Stabilizer and Replenisher	5,10 L 12.5 gal	70–100 (21–37.8)	994 900	6.0 6.0	— —	— —	— —	— 1 L
EKTACHROME R-3 (Process R-3)								
First Developer II Replenisher	12.5 gal	80–100 (27–37.8)	600	320.0	—	—	—	1 L
Color Developer II Replenisher	25 gal	80–100 (27–37.8)	800	40.0	40.0	80.0	—	1 L
Bleach-Fix II and Replenisher	12.5 gal	80–100 (27–37.8)	680	154.0	115.0	—	—	1 L

* Adjust pH to 5.0 ±0.1 to make replenisher. Specific gravity aim is 1.054 ±0.003 at 86°F.

† Adjust pH to 7.5. Specific gravity aim is 1.091 ±0.005 at 86°F.

‡ Adjust pH to 7.5.

Table 2
Processing Kits (Small Sizes)

These kits make working-tank solutions without starters.

KODAK Chemical	Package Size	Mixing Temperature °F (°C)	Starting Water (mL)	Part A (mL)	Part B (mL)	Part C (mL)	Add Water to Make
Process E-6							
First Developer	1 gal*	68–104 (20–40)	650	183.0	—	—	1 L
	5 L†		600	200.0	—	—	1 L
Reversal Bath	1 gal*	68–104 (20–40)	750	62.5	—	—	1 L
	5 L†		600	25.0	—	—	1 L
Color Developer	1 gal*	68–104 (20–40)	600	183.0	62.0	—	1 L
	5 L†		600	142.5	47.0	—	1 L
Pre-Bleach	1 gal	68–104 (20–40)	750	200.0	—	—	1 L
	5 L†		600	70.0	—	—	1 L
Bleach	1 gal*	68–104 (20–40)	350	500.0	15.6	—	1 L
	5 L†		600	310.0	—	—	1 L
Fixer	1 gal*	68–104 (20–40)	700	125.0	—	—	1 L
	5 L†		600	70.0	—	—	1 L
Final Rinse	1 gal*	68–104 (20–40)	850	7.5	—	—	1 L
	5 L†		850	10.0	—	—	1 L
FLEXICOLOR (Process C-41)							
Developer	1 gal	80–90 (27–32)	750	73.6	6.50	15.6	1 L
	3.5 gal		750	73.6	8.67	8.91	1 L
Bleach III	1 gal	Ready-to-use solution					
Fixer	1 gal	80–90 (27–32)	650	200.0	—	—	1 L
Stabilizer III	1 gal	70–80 (21–27)	800	15.0	—	—	1 L
EKTACOLOR RA (Process RA-4)							
Developer	1 gal	70–100 (21–37.8)	800	62.5	31.2	62.5	1 L
Bleach-Fix	1 gal	70–100 (21–37.8)	600	125.0	187.0	—	1 L
EKTACHROME R-3000 (Process R-3000)							
First Developer	1 gal	70–100 (21–37.8)	750	200.0	—	—	1 L
Color Developer	1 gal	90–100 (32–37.8)	800	40.0	60.0	60.0	1 L
Bleach-Fix	1 gal	70–100 (21–37.8)	650	188.0	125.0	—	1 L

* Parts available individually (i.e., not available in a kit).

† Available in 5-L size only in KODAK PROFESSIONAL Single-Use Chemistry Kit, Process E-6.

Table 3
Preparing Tank Solutions from Replenisher Solutions

Chemical	Start with This Amount of Replenisher (mL)	Add This Amount of Water (mL)	Add This Amount of Starter (mL)	To Prepare This Amount of Tank Solution
Process E-6				
First Developer	950	50	6.0*	1 L
Reversal Bath	800	200	—	1 L
Color Developer	850	150	5.0†	1 L
Color Developer Replenisher LORR	750	250	9.0†	1 L
Pre-Bleach	Use mixed replenisher as tank or replenisher solution.			
Bleach 4 min	600	380	20.0‡	1 L
Bleach 6 min	500	480	20.0‡	1 L
Fixer	Use mixed replenisher as tank or replenisher solution.			
Final Rinse	Use mixed replenisher as tank or replenisher solution. Do not use with Process C-41.			
FLEXICOLOR (Process C-41)				
Developer	860	126	14.0§	1 L
AR Developer	860	126	14.0§	1 L
Developer LORR	763	207	30.0¶	1 L
Bleach III Replenisher	870	80	50**	1 L
Bleach III NR Replenisher	750	200	50**	1 L
RA Bleach Replenisher NR	880	—	120**	1 L
Fixer and Replenisher	862	138	—	1 L
RA Fixer and Replenisher	Use mixed replenisher as tank or replenisher solution.			
ELECTROSILVER Fixer and Replenisher LORR	750	250	—	1 L
Stabilizer III and Replenisher	Use mixed replenisher as tank or replenisher solution.			
Final Rinse	Use mixed replenisher as tank or replenisher solution.			
EKTACOLOR RA (Process RA-4)				
Developer Replenisher	700	275	25.0††	1 L
Developer Replenisher RT	800	175	25.0††	1 L
Developer Replenisher, 12	600	370	30.0††	1 L
PRIME SP Developer Replenisher	500	460	40.0††	1 L
PRIME Developer Replenisher LORR	600	360	40.0††	1 L
RA 100 Bleach-Fix	500	500	—	1 L
PRIME Bleach-Fix Replenisher	500	500	—	1 L
Bleach-Fix	Use mixed replenisher as tank or replenisher solution.			
Bleach-Fix Replenisher NR	500‡‡	500	—	1 L
Bleach (using RA Bleach Regenerator concentrate)	165	835	—	1 L§§
Bleach (using RA Bleach Replenisher)	660	340	—	1 L§§
Fixer (using RA Fixer Regenerator concentrate)	167	833	—	1 L¶¶
Fixer (using RA Fixer Replenisher)	500	500	—	1 L¶¶
PRIME Stabilizer	Use mixed replenisher as tank or replenisher solution.			

* First Developer Starter, Process E-6, CAT No. 156 4871.
† Color Developer Starter, Process E-6, CAT No. 156 4012.
‡ Bleach Starter, Process E-6, CAT No. 177 9792.
§ FLEXICOLOR Developer Starter, CAT No. 195 3009.
¶ FLEXICOLOR Developer Starter LORR, CAT No. 848 5153.
** FLEXICOLOR Bleach Starter, 1-gal concentrate, CAT No. 856 6796.
†† EKTACOLOR RA Developer Starter, CAT No. 102 6681.
‡‡ Use 50 percent of Part C when preparing replenisher to make a tank solution.
§§ Adjust pH to 5.0 ±0.1. Specific gravity aim is 1.035 ±0.003 at 86°F.
¶¶ Adjust pH to 7.5. Specific gravity aim is 1.048 ±0.003 at 86°F.

Preparing Tank Solutions from Replenisher Solutions (continued)

Chemical	Start with This Amount of Replenisher (mL)	Add This Amount of Water (mL)	Add This Amount of Starter (mL)	To Prepare This Amount of Tank Solution
EKTACHROME R-3 (Process R--3)				
First Developer II	995	—	5.0*	1 L
Color Developer II	800	192.5	7.5†	1 L
Bleach-Fix II and Replenisher	Use mixed replenisher as tank or replenisher solution.			

* EKTACHROME R-3 First Developer II Starter, 8-oz bottle, CAT No. 869 9795.

† EKTACHROME R-3 Color Developer II Starter, 12-oz-bottle, CAT No. 878 3557.

Table 4

Preparing Tank Solutions from 55-Gallon Drums or AR Cubitainers of Concentrate

Chemical	Package Size	Mixing Temperature °F (°C)	Total Water (mL)	Part A (mL)	Part B (mL)	Part C (mL)	Conv (mL)	Starter (mL)	To Prepare This Amount of Tank Solution
EKTACOLOR RA (Process RA-4)									
RA Developer Regenerator, 12/55	55-gal drums	70–100 (21–37.8)	883	24	15	24	24*	30†	1 L
FLEXICOLOR (Process C-41)									
AR Developer Replenisher	Part A 5-gal conc Part B 1-gal conc Part C 1-gal conc	70–100 (21–37.8)	901	68.8	7.9	8.3		14‡	1 L

* EKTACOLOR RA Developer Regenerator Converter, Process RA-4, CAT No. 896 9453.

† EKTACOLOR RA Developer Starter, CAT No. 102 6681.

‡ FLEXICOLOR Developer Starter, CAT No. 195 3009

Preparing Smaller-Than-Package-Size Amounts of KODAK Processing Chemicals

STORING AND HANDLING KODAK PHOTOGRAPHIC CHEMICALS

Unopened Chemicals—Processing chemicals in the original unopened containers are the easiest to handle and store. Follow the recommendations on the package. Avoid storing dry chemicals on floors that are damp or susceptible to water overflows from sinks, clogged drains, etc. Store unopened chemicals on a wooden platform about four inches high.

Storage Temperature—Store chemicals at 40 to 80°F (4.4 to 26.6°C). Below that temperature range, ingredients in liquid concentrates may come out of solution or crystallize. Higher temperatures accelerate chemical reactions and cause deterioration. As a general rule, every increase of 10°F (5.5°C) will double reaction rates.

Store chemicals in a cool, dry place. In warm climates, storage temperatures of 140°F (60°C) can make chemicals unusable in just a few days. This applies to almost all processing chemicals, with the possible exception of stop bath, which is not as affected by heat.

Working Solutions and Oxidation—Once the original container is opened, the chemicals are exposed to oxidation. Reaction of chemicals, especially developers, with oxygen in the air will gradually cause them to deteriorate. Oxidation continues to some extent even if the container is immediately resealed. You can reduce oxidation by storing working solutions in amounts that can be used all at one time. For example, if you open a 10-gallon-size package, mix the entire amount, and then store the solution in 1-gallon containers. Then, each time you open a container you can use the entire amount, and the remaining mix is not exposed to air.

Chemical Containers—When you use plastic bottles to store working solutions, fill the bottle to the top and cap it tightly to exclude air completely. The best way to do this is to squeeze the bottle gently before you cap it to raise the chemical level to the top of the neck.

When you fill glass bottles, leave a small amount of air at the top of the neck before capping. This is necessary because chemical expansion due to temperature or pressure changes can cause a completely filled glass bottle to burst. Glass, however, is preferable to plastic for storing photographic chemicals for long periods because air can slowly penetrate plastic.

Flexible plastic containers stored in a cardboard box can minimize oxidation. The plastic container collapses as chemicals are removed, thereby minimizing the amount of air in the container. With rigid bottles and drums, air remains inside, causing oxidation. With drums, you must consider the method of dispensing the chemicals. A drum stored on its side will expose a greater liquid surface area to the air than a drum stored upright. No container can completely stop aerial oxidation; it can only minimize it.

Liquid and Dry Chemicals—Dry chemicals have a longer shelf life than liquid concentrates, and both unopened dry chemicals and liquid concentrates keep considerably longer than working solutions. For that reason, mix the smallest amount of working solution that you will need for your processing conditions.

Liquid chemical concentrates are uniform throughout. You can use small portions as needed to mix any amount of working solution. However, with dry chemicals, mix the entire contents at one time because the chemicals are not uniform throughout. Shipping and handling will cause the ingredients to settle in different ways. As a result, working solutions made from portions of dry packaged chemicals may be nonuniform and inconsistent. Once dry chemicals are converted to liquid working solutions, you can then subdivide them for use and storage.

Read the Mixing Instructions—The most up-to-date source of information on mixing and storing chemicals is the instructions provided with each chemical. Instructions are written to provide you with accurate information. Follow instructions carefully to save money.

Consumer Imaging
EASTMAN KODAK COMPANY • ROCHESTER, NY 14650

